

Service Bulletin

Energica Motor Company SpA

Via Scarlatti, 20 - 41019 Soliera (MO) - ITALY

serviceandparts@energicamotor.com



ENERGICA

CIRCOLARE TECNICA - SERVICE BULLETIN - TECHNISCHES RUNDSCHREIBEN - CIRCULAIRE TECHNIQUE - CIRCULAR TECNICA

Subject:	DROP OF TRANSMISSION OIL LEVEL CHECK
Technical info n°:	22-SI-2723. DROP OF TRANSMISSION OIL LEVEL CHECK v.2
Issue Date:	July 04th, 2023
Models:	EXPERIA
VIN numbers:	VIN number list below
Group:	Maintenance
Type:	Bulletin
Supersedes:	22-SI-2723. DROP OF TRANSMISSION OIL LEVEL CHECK

REFERENCE

ESP - Energica Service Portal

Home / Service / Technical service bulletin / 22-SI-2723. TRANSMISSION OIL LEVEL CHECK v.2

PURPOSE

The purpose of this bulletin is to inform dealers that Energica has noted, in a specific batch of motorcycles, a possible a drop of transmission oil level.

The VIN numbers of the Energica Experia that could be affected are li listed on the following page.

If the motorcycle is located at the dealership, we kindly request that you perform this check as promptly as possible.

If the motorcycle is with a customer, please conduct this inspection at the earliest opportune service appointment in accordance with the "Regular maintenance intervals" guidelines.

If the user has reported excessive noise coming from the motor, it is recommended to perform this inspection as soon as possible, as requested.

CAUTION: MOTORCYCLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

EMC bulletin are intended for use by professional technicians, NOT a "do it yourselfer". They are written to inform these technicians of conditions that may occur on some motorcycles, or to provide information that could assist in the proper service of a motorcycle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, DO NOT assume that this SERVICE BULLETIN applies to your motorcycle, or that your motorcycle will have that condition. No part of this TSB is to be reproduced or made public without the express written consent of EMC.

Service Bulletin

Energica Motor Company SpA

Via Scarlatti, 20 - 41019 Soliera (MO) - ITALY

serviceandparts@energicamotor.com



ENERGICA

CIRCOLARE TECNICA - SERVICE BULLETIN - TECHNISCHES RUNDSCHREIBEN - CIRCULAIRE TECHNIQUE - CIRCULAR TECNICA

PRECONDITIONS

The motorcycle's serial number must be included within this list.

We kindly request you to provide us with feedback (kilometers/miles traveled and the result of the inspection) on the listed VINs both in the case of normal conditions and in the event that a lower-than-normal oil level is detected.

VIN NUMBER LIST

ZNNF2B1A9PS000006	ZNNF2B187RS000084
ZNNF2B1A2PS000008	ZNNF2B189RS000085
ZNNF2B1A4PS000009	ZNNF2B180RS000086
ZNNF2B1A0PS000010	ZNNF2B182RS000087
ZNNF2B1A2PS000011	ZNNF2B184RS000057
ZNNF2B1A4PS000012	ZNNF2B186RS000058
ZNNF2B1A6PS000013	ZNNF2B188RS000059
ZNNF2B1A8PS000014	ZNNF2B184RS000060
ZNNF2B1AXPS000015	ZNNF2B188RS000062
ZNNF2B1A1PS000016	ZNNF2B18XRS000063
ZNNF2B1A3PS000017	ZNNF2B181RS000064
ZNNF2B1A5PS000018	ZNNF2B183RS000065
ZNNF2B1A9PS000023	ZNNF2B185RS000066
ZNNF2B1A0PS000024	ZNNF2B189RS000068
ZNNF2B186RS000027	ZNNF2B180RS000069
ZNNF2B188RS000028	ZNNF2B187RS000070
ZNNF2B18XRS000029	ZNNF2B189RS000071
ZNNF2B186RS000030	ZNNF2B180RS000072
ZNNF2B188RS000031	ZNNF2B182RS000073
ZNNF2B18XRS000032	ZNNF2B184RS000074
ZNNF2B181RS000033	ZNNF2B186RS000075
ZNNF2B183RS000034	ZNNF2B188RS000076
ZNNF2B185RS000035	ZNNF2B18XRS000077
ZNNF2B187RS000036	ZNNF2B181RS000078
ZNNF2B189RS000037	ZNNF2B183RS000079
ZNNF2B180RS000038	
ZNNF2B182RS000039	
ZNNF2B180RS000041	
ZNNF2B182RS000042	
ZNNF2B184RS000043	
ZNNF2B186RS000044	
ZNNF2B188RS000045	
ZNNF2B18XRS000046	
ZNNF2B181RS000047	
ZNNF2B183RS000048	
ZNNF2B185RS000049	
ZNNF2B181RS000050	
ZNNF2B183RS000051	
ZNNF2B185RS000052	
ZNNF2B187RS000053	
ZNNF2B189RS000054	
ZNNF2B180RS000055	
ZNNF2B182RS000056	

CAUTION: MOTORCYCLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

EMC bulletins are intended for use by professional technicians, NOT a "do it yourselfer". They are written to inform these technicians of conditions that may occur on some motorcycles, or to provide information that could assist in the proper service of a motorcycle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, DO NOT assume that this SERVICE BULLETIN applies to your motorcycle, or that your motorcycle will have that condition. No part of this TSB is to be reproduced or made public without the express written consent of EMC.

Service Bulletin

Energica Motor Company SpA

Via Scarlatti, 20 - 41019 Soliera (MO) - ITALY

serviceandparts@energicamotor.com

CIRCOLARE TECNICA - SERVICE BULLETIN - TECHNISCHES RUNDSCHREIBEN - CIRCULAIRE TECHNIQUE - CIRCULAR TECNICA




ENERGICA


REQUIRED DEALER ACTIONS

First and foremost, please verify the correct transmission oil level as indicated on page 205 of the Service Manual. If you find the oil level to be at or above the specified range, there is no need to proceed with any further checks.

Check the transmission oil level

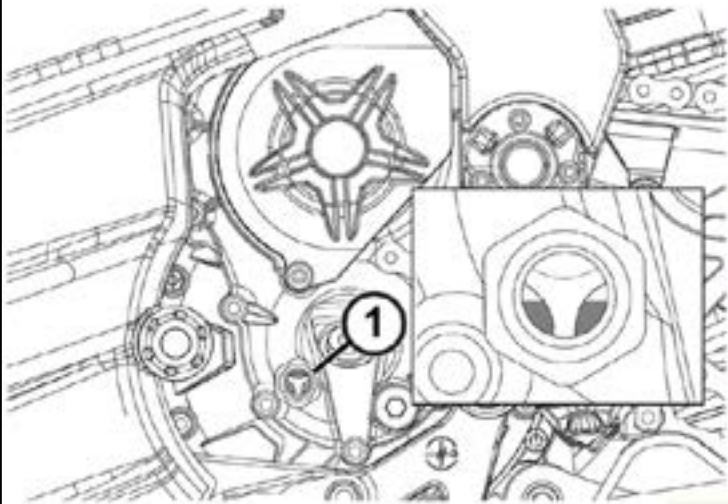

1.1.1 Check the transmission oil level through the inspection window on the left-hand side of the motor.

 These operations must be performed with the motorcycle perfectly vertical.

1.1.2 The level should be as shown in the illustration.

1.1.3 If the level is lower than the minimum mark, perform a top-up.

Figure 1

However, if the oil level does not meet the required specifications, it is required to top up the transmission oil to the correct level as described in chapter 2.11 of the service manual.

Subsequently, we kindly request that you proceed with the subsequent operations (estimated time 40 min.).

- 1- switch the vehicle OFF and remove the key from the ignition.
- 2- set the vehicle on the rear stand.

CAUTION: MOTORCYCLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

EMC bulletin are intended for use by professional technicians, NOT a "do it yourselfer". They are written to inform these technicians of conditions that may occur on some motorcycles, or to provide information that could assist in the proper service of a motorcycle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, DO NOT assume that this SERVICE BULLETIN applies to your motorcycle, or that your motorcycle will have that condition. No part of this TSB is to be reproduced or made public without the express written consent of EMC.

Service Bulletin

Energica Motor Company SpA

Via Scarlatti, 20 - 41019 Soliera (MO) - ITALY

serviceandparts@energicamotor.com

CIRCOLARE TECNICA - SERVICE BULLETIN - TECHNISCHES RUNDSCHREIBEN - CIRCULAIRE TECHNIQUE - CIRCULAR TECNICA



ENERGICA

- 3- (Figure 2) - move to the left side of the motorcycle and remove the 2 indicated screws along with the kickstand bracket.



Figure 2

- 4- (Figure 3) - loosen the indicated pin screw without completely removing it.



Figure 3

CAUTION: MOTORCYCLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

EMC bulletins are intended for use by professional technicians, NOT a "do it yourselfer". They are written to inform these technicians of conditions that may occur on some motorcycles, or to provide information that could assist in the proper service of a motorcycle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, DO NOT assume that this SERVICE BULLETIN applies to your motorcycle, or that your motorcycle will have that condition. No part of this TSB is to be reproduced or made public without the express written consent of EMC.

Service Bulletin

Energica Motor Company SpA

Via Scarlatti, 20 - 41019 Soliera (MO) - ITALY

serviceandparts@energicamotor.com



ENERGICA

CIRCOLARE TECNICA - SERVICE BULLETIN - TECHNISCHES RUNDSCHREIBEN - CIRCULAIRE TECHNIQUE - CIRCULAR TECNICA

- 5- (Figure 4) - rotate the kickstand support as shown in order to access and remove the indicated screw.

Within this section of the motor, verify the presence of oil traces by inserting a cable tie. If oil is found in this area, report it to Energica Motor Company.



Figure 4

- 6- (Figure 5) – proceed to close this compartment, tightening the indicated screw to **10 Nm**



Figure 5

CAUTION: MOTORCYCLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

EMC bulletin are intended for use by professional technicians, NOT a “do it yourselfer”. They are written to inform these technicians of conditions that may occur on some motorcycles, or to provide information that could assist in the proper service of a motorcycle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, DO NOT assume that this SERVICE BULLETIN applies to your motorcycle, or that your motorcycle will have that condition. No part of this TSB is to be reproduced or made public without the express written consent of EMC.

Service Bulletin

Energica Motor Company SpA

Via Scarlatti, 20 - 41019 Soliera (MO) - ITALY

serviceandparts@energicamotor.com

CIRCOLARE TECNICA - SERVICE BULLETIN - TECHNISCHES RUNDSCHREIBEN - CIRCULAIRE TECHNIQUE - CIRCULAR TECNICA



ENERGICA

- 7- (Figure 6) Fit the kickstand support in the original position and apply an adequate amount of **Loctite 243** thread locker on the thread of the previously removed screws and **tighten to 40 Nm**



Figure 6

- 8- (Figure 7) - tighten the indicated pin screw to 40 Nm



Figure 7

CAUTION: MOTORCYCLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

EMC bulletins are intended for use by professional technicians, NOT a "do it yourselfer". They are written to inform these technicians of conditions that may occur on some motorcycles, or to provide information that could assist in the proper service of a motorcycle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, DO NOT assume that this SERVICE BULLETIN applies to your motorcycle, or that your motorcycle will have that condition. No part of this TSB is to be reproduced or made public without the express written consent of EMC.

Service Bulletin

Energica Motor Company SpA

Via Scarlatti, 20 - 41019 Soliera (MO) - ITALY

serviceandparts@energicamotor.com

CIRCOLARE TECNICA - SERVICE BULLETIN - TECHNISCHES RUNDSCHREIBEN - CIRCULAIRE TECHNIQUE - CIRCULAR TECNICA



ENERGICA

In case oil traces are found as described in point 5 (figure 4), we kindly request you to report it to Energica Motor Company.

Thank you for your cooperation.

AFFECTED DEPARTMENTS

Please ensure this bulletin is read and initialed by

SERVICE MANAGER	SALES MANAGER	PARTS MANAGER	WARRANTY PROCESS MANAGER	LEAD TECHNICIAN	ACCESSORIES
			X	X	

CAUTION: MOTORCYCLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

EMC bulletin are intended for use by professional technicians, NOT a “do it yourselfer”. They are written to inform these technicians of conditions that may occur on some motorcycles, or to provide information that could assist in the proper service of a motorcycle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, DO NOT assume that this SERVICE BULLETIN applies to your motorcycle, or that your motorcycle will have that condition. No part of this TSB is to be reproduced or made public without the express written consent of EMC.